

## INFO SHEET

### Discussion about Coatings and Hydrostatic Pressure

Hi Performance Pool Coatings can generally be considered both water and vapour proof. This means that neither liquid water nor water vapour (gas) can pass easily through the coating when applied at the correct film thickness.

Concrete is a hydroscopic material meaning it tends to absorb moisture like a sponge. If humidity on one side is different to the other, it will transmit moisture as liquid or gas, through the concrete.

**Hydrostatic water pressure:** Hydrostatic or “head” pressure is the force caused by a column of liquid water, which generally does not harm solid concrete. However, it will force itself through as a liquid, even in quite dense concrete, especially if there are imperfections such as sand streaking, honey combing, cracks and areas of lower density. Higher water - cement ratio concrete (<0.40) tends to form more permeable concrete, with lots of capillaries being created. Hydrostatic water pressure is only a problem when liquid water is in direct contact with the concrete mass.

**Water Vapour:** Water vapour (gas) molecules (not liquid) can more easily pass through mass concrete, and they are much smaller and compressible too. This tends to be more of a problem in areas of high-water table, or where the waterproof membrane (if installed) has failed.

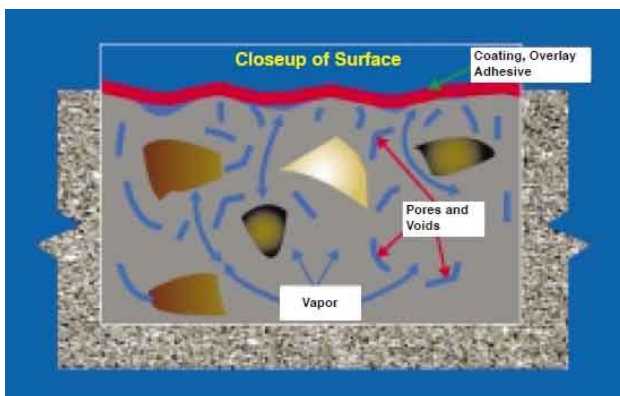


Figure 1 Voids in concrete provide space for condensation

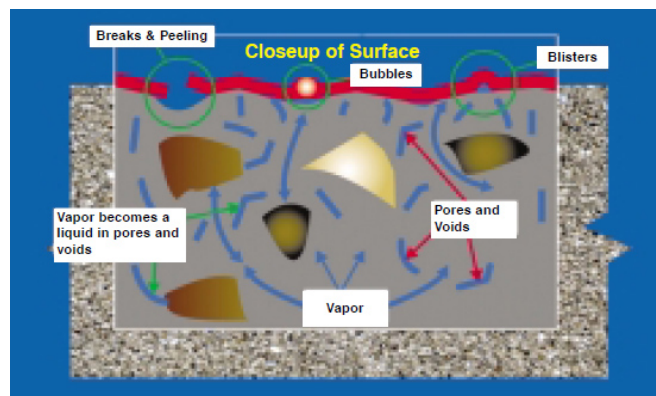
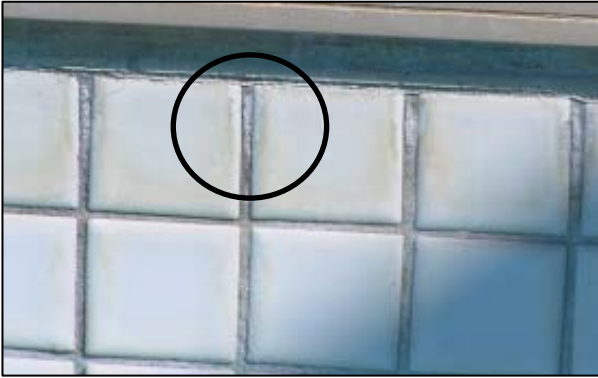


Figure 2 A void near the surface can lead to de bonding

**What causes the Water Vapour to move within concrete?** As gases can change shape they can wiggle through tiny voids as small as 5 micrometers. The gas is harmless to the concrete, however when it condenses into water it takes on a much bigger size. As the concrete cools (such as in winter - pool water cools) its ability to keep the water vapour in a gaseous phase diminishes and it condenses into liquid. This “new” water will have a pH of 7 which allows it to attack other molecules in the voids including weak cement ions and this continues enlarging the void. Over time the destructive effect grows, and other molecules previously bound to the now missing cement molecules, are affected. When these voids are near the surface of the concrete, large voids cause the de bonding of the surface of the concrete and any coating attached to it. Also, when vapour turns into liquid, another force is created called capillary action. The “new” water is attracted more to the surrounding surfaces (inside of voids) than to itself. Meaning it can move around both vertically and horizontally within the pores and capillaries in the concrete. As this water gets near the outer deteriorating concrete surfaces just below the coating, it will often force the coating to blister or bubble just before final delamination.

**Other related causes:** These can be from rain runoff, such as when water absorbed into the soil near the pool and runs past, under or around the pool and in so doing saturates the pool structure. This can be seen on pools on hillsides and near to buildings where the collection of water from nearby areas is channeled to areas around the pool. Pathways, patios and lawns near pools are also ways to generate large areas that saturate ground with rain runoff, causing the pool to get “wet feet.” Sometimes we find leaking plumbing can also be a cause, especially if blisters are near outlets below the water line.



**Figure 3 Showing telltale efflorescence on tile grout indicating water passing out from pool shell.**



**Figure 4 Effects of poor drainage around pool and causing in part delamination of render.**

**What do you see?** Fortunately, in our experience it's not a common problem as most pools are well constructed and in dry areas. Often in pools painted with thick coatings, if there is to be an issue with this, it will show up after some time. (Months to years) The exception is when heavy rain has occurred soon after application and the ground is wet. (higher water table). Also, more often than not it will be seen first on pool walls that face North to Northwest (Heated by sun generating higher temperatures and causing more water vapour activity within the walls). It may also happen on other walls if they have areas of porosity within, including cold concrete – render joints.

To check, drop the water level enough to expose some blisters. Carefully pry it open with a sharp knife. If water comes out (maybe dark in colour) it confirms hydrostatic pressure is the cause.

Sometimes blisters are seen on the pool floor, but this is usually long after it's seen in the walls. Pool surrounds (coping and paths) that are dark coloured also impact on the rate of activity as they absorb more heat from the sun, drawing moisture up the walls to the top.

**Why do I see it on my pool now?** If the pool was not coated but had a rendered surface or Marblesheen or Pebblecrete finish, these are all quite porous and the effect will have been going on but as they are porous surfaces no noticeable defect occurs. Even if a painted pool before, the then paint film may be quite thin (porous) or worn away so the effect will not be easily seen. This issue largely arises and is noticeable when an impermeable coating is applied. Such coatings make for a much easier pool surface to keep clean as algae and dirt don't stick but may have this drawback.

**How to deal with this?**

In simple terms there is no easy answer. The primary cause being due to the condition of the concrete within, not something you will be familiar with. Often it maybe a pool that has been painted before and has not shown this as an issue. Now after re coating it does. It may be due to a lot of rain saturating the ground around the pool.

The natural idea is to empty the pool and have it recoated. This may or may not be successful. Simply doing so may in fact result in the same outcome again for the reasons explained above.

Or one may leave the pool and see if there are other ways to direct the rain or water away from the pool. Such as making sure rain is not directed anywhere near the pool or if it is, adding drainage nearby so it can escape quickly, before saturating the soil near the pool.

**If so, these should be attempted first.**

If not appropriate or not relevant to your pool, then consider the climate and in some cases recent above average rainfall. If this is the likely cause, then maybe it is best to leave the pool as is for a few years until the weather patterns are dryer (rainfall tends to be in cycles) then empty, prepare and recoat. If you follow this suggestion the blisters may continue to develop during the few years while you wait and then slow down as the hydrostatic pressure becomes less. The blisters may break and yes allow water into the structure which helps the equalisation somewhat. However, be aware that the blisters may return after the pool is recoated.

The other way is to consider a permeable finish that will allow this hydrostatic situation to continue, unheeded.

Contact us for more detailed information re your pool. We are happy to assist.

**HITCHINS TECHNOLOGIES PTY LTD** ACN 119 448 501, **Postal:** PO Box 3186, **Bonnells Bay NSW 2264, Australia**  
**Phone:** 1300 8879 20 **Fax:** **Web:** [www.poolpaint.com.au](http://www.poolpaint.com.au) **Email:** [info@poolpaint.com.au](mailto:info@poolpaint.com.au)

All information is given in good faith but without warranty. No liability will be accepted for any damage, loss or patent infringement from use of this information. This information does not constitute a specification and is subject to modification in the course of further development



**Figure 5 Painted wall showing hydrostatic blisters**